

SERVICE BULLETIN

SB No.

52

Issue No.

1

TITLE

ELEVATOR HORN WATER INGRESS

CLASSIFICATION

This Service Bulletin has been classified as Mandatory

COMPLIANCE

Before 30th June 1994.

APPLICABILITY:

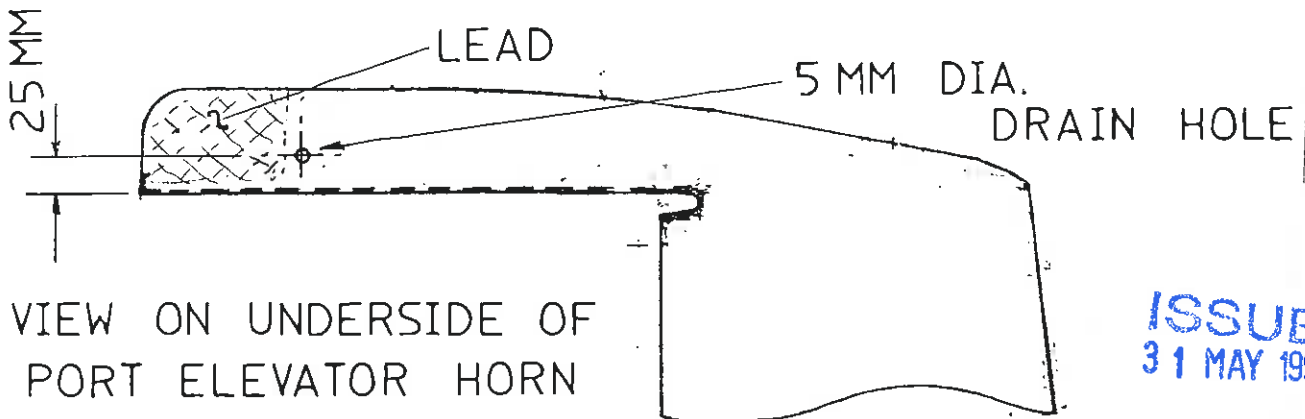
All T67 GRP series aircraft.

INTRODUCTION:

An annual inspection on an elevator had found a quantity of water inside the horn balance.

ACTION:

1. Deflect elevators to up position.
2. By tapping the inside face of the horn balance with a coin, the position of the lead balance weight can be ascertained.
3. Ref. Fig 1 drill 5mm dia hole in the lower skin of the horn in the hollow portion as close to the lead balance as possible.
4. Check the condition of the vinyl disc T67B-00-301 which covers the elevator hinge pivot. Renew as necessary.


 ISSUED
 31 MAY 1994

ISSUED BY:



Date

 27th May 94.

 for and on behalf of **SLINGSBY AVIATION LIMITED**
 Kirkbymoorside York YO6 6EZ England

Tel 0751 32474 Telex 57597

Page

1

of

1