



SERVICE BULLETIN

SB No.

73

Issue No.

1

TITLE

**INSPECTION OF LEFT, RIGHT AND TAIL NAVIGATION
LIGHT LENS GASKETS**

CLASSIFICATION

Highly Recommended

COMPLIANCE

At next 100 hr check or within 3 months from receipt of bulletin.

APPLICABILITY:

- A) Tail Light : All T67 Series
- B) Wing Tip Nav Lights : T67C Series
T67M-MkII, T67M200
T67M260, T67M260-T3A
(ie Post Mod 297)

INTRODUCTION:

There has been a report of missing or damaged gaskets in the left and right navigation lights. Also the gasket fitted in the rear navigation light is of the hard fibre type. In these instances it is possible for water, oil or other contaminants to enter the light units and obscure the lenses.

ACTION

1. Remove lenses from left and right navigation lights and inspect lens gaskets. If gaskets are damaged, deformed or missing, fit new lens gasket Part No. 126-31-296 and re-fit lenses.
2. Remove lens from rear nav light (Grimes A2064-1683, 126-31-204). Remove and discard fibre gasket if fitted. Re-fit lens using soft rubber gasket Part No. 126-31-296.
3. When soft rubber gasket is fitted, rear nav light assembly A2064-1683, 126-31-204 becomes re-identified as T67B-81-834.
4. Annotate Aircraft Logbook "Service Bulletin No.73 complied with" and SAL Mod 657 is invoked.

ISSUED BY:


Date

8-3-95

for and on behalf of

SLINGSBY AVIATION LIMITED

Kirkbymoorside York YO6 6EZ England Tel 0751 32474 Telex 57597

Page

1

of

1