**SERVICE BULLETIN**

SB No. 032

Issue No. 2

TITLE

KING RADIO KCS 55A SLAVED GYROCOMPASS SYSTEM - ERRONEOUS READINGS

CLASSIFICATION

This Service Bulletin has been classified as Mandatory by the U.K. C.A.A.

COMPLIANCE

Within the next 25 flying hours.

APPLICABILITY

As S.B. 32 Issue No.1.

INTRODUCTION:

Bendix/King have introduced a filter network which, when fitted to the gyro unit (KG 102A), cures the previously described problem of erroneous readings. Installation of this unit has been given Slingsby Mod No. M417.


ACTION:

1. Install the filter network P/N 200-05058-0000 Filter Assembly 050-02160-0000 Installation Kit in accordance with King Installation Bulletin 310.
2. Remove T.A.L. 3 from the Flight Manual.
3. Record incorporation of Slingsby Mod M417 in the Aircraft Log Book.

Compliance with Issue 2 of S.B. 032 satisfies the requirements of SAL Mod M417.

ISSUED
7 NOV 1989

ISSUED BY:

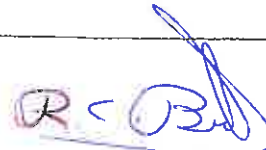

for and on behalf of

SLINGSBY AVIATION PLC

Kirkbymoorside York YO6 6EZ England Tel 0751 32474 Telex 57597

Date 6th Nov 1989.

Page 1 of 1

Page of